




AUDI A1: 1GJE578			
Vinnnumber:	WAUZZ8X2EB081983	Versionname:	A1 SB Attraction 90PK
First Registrationdate:	21/02/2014	Fiscalpower:	
Expertise Mileage:	139624	Power Kw:	66
Bodytype:		Body color	Black
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2109
Number of doors	5		
Number of seats	4		
Number head rests	4		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options	
Radio CD	Luggage cover
GPS storage	SD Rear parking sensors
GPS storage	
Windows electric F	
Windows electric R	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control







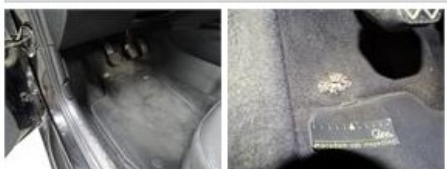

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/55/15/88 H LightMetal			
Winter tyres:	Fr.L.	Semperit: 5 mm	Fr.R.	Semperit: 5 mm
	Re.L.	Semperit: 6 mm	Re.R.	Semperit: 6 mm

Assistance equipment	
Repair kit	Yes Compressor Yes
Total cost ex VAT	351,95
Trunk lid covering R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Floor covering F L, Hole, Smart repair	64,32



Interior, Dirty, Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Bad repair, Acceptable	0,00

<i>No pictures to display</i>		
Wing F L, Bump(s), PDR - Knock out without painting		63,00
		
Roof, Chemical polution, 67 - Polish		55,19
		
Front bumper, Scratch(es), LI - Repair and paint (complete)		169,44
		
Rearview mirror housing R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		