


FORD S-MAX: 1NLU155

Vinnumber:	WF0SXXGBWSBK57622	Versionname:	
First Registrationdate:	24/02/2011	Fiscalpower:	
Expertise Mileage:	97053	Power Kw:	149
Bodytype:	MPV	Body color:	Dark Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4715
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Seats electric F L
Windows electric F	Seats electric F R
Windows electric R	Panoramic roof
Cruise Control	Central consol F
Steering wheel multifunctional	Front parking sensors
Radio multimedia	Rear parking sensors
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining leather and alcantara
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	235/45/18/98 Y LightMetal			
Summer tyres:	Fr.L.	Pirelli: 4 mm	Fr.R.	Pirelli: 4 mm
	Re.L.	Pirelli: 5 mm	Re.R.	Pirelli: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------


Total cost ex VAT	816,42
Tailgate, Scratch(es), Acceptable	0,00

No pictures to display

Door panel F L, Not original part, Acceptable	0,00
---	------



Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete)	264,21
---	--------

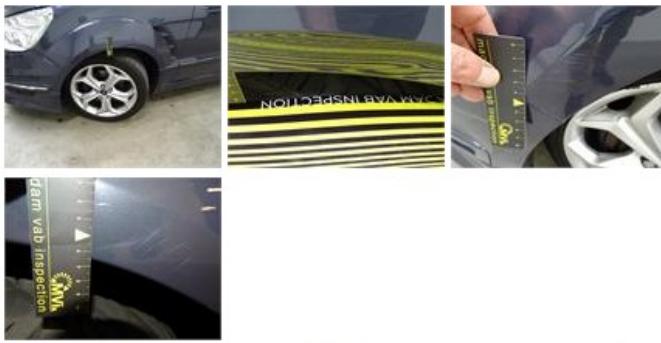

Luggage space cover, Missing, E - Replace 288,00



Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Door panel F R, Not original part, Acceptable 0,00



Roof pillar R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 264,21



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display