



RENAULT Clio: 1FNE193

Vinnnumber:	VF17R040H49430050	Versionname:	CLIO IV BRE Expression
First Registrationdate:	27/08/2013	Fiscalpower:	75PK
Expertise Mileage:	131046	Power Kw:	55
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3813
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	185/65/15/88 T Steel			
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	823,80
-------------------	---------------

Wheel cover F L, Scratch(es), Acceptable	0,00
--	-------------

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete)	254,68
---	---------------




Wheel cover R L, Scratch(es), E - Replace	24,00
---	--------------





Windscreen, Stone chip(s), Windscreen repair 58,80

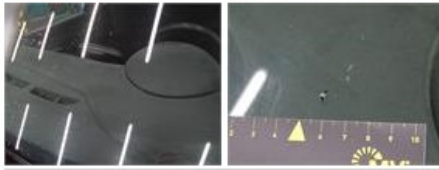

Roof pillar R, Bump(s), Acceptable 0,00

No pictures to display

Door R L, Bump(s), Acceptable 0,00

No pictures to display


Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover F L, Stain, Cleaning 25,00



Door F L, Bump(s) and scratch(es), LI - Repair and paint (complete) 302,68

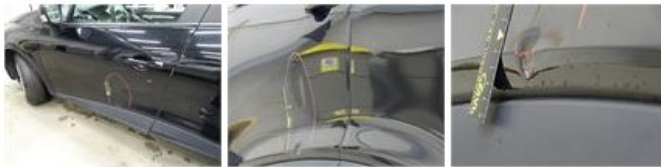

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Scratch(es), Acceptable 0,00

No pictures to display

Dashboard, Damaged, Smart repair 110,64



Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R R, Scratch(es), E - Replace 24,00



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace 24,00

