



VOLKSWAGEN Passat: 1EYC115

Vinnnumber:	WVWZZZ3CZDE137996	Versionname:	PASSAT VAR Trendline BM
First Registrationdate:	18/04/2013	Fiscalpower:	105PK
Expertise Mileage:	143883	Power Kw:	77
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4507
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	HD Front parking sensors
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	NOT OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V Steel				
Summer tyres:	Fr.L.	Michelin: 1,8 mm	Fr.R.	Michelin: 1,8 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1576,58
Bumper grille F R, Broken, E - Replace			69,00



Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Seat cover F R, Stain, Cleaning	25,00



Roof, Chemical polution, LI - Repair and paint (complete) 481,50

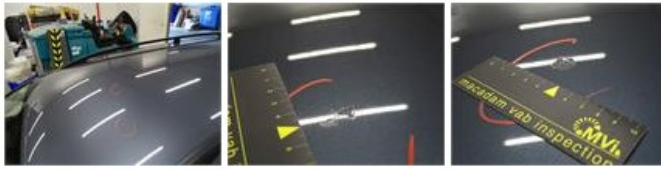

Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display


Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace 30,00

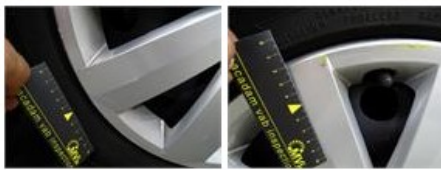


Wheel cover R R, Scratch(es), E - Replace 30,00



Bumper R, Broken, Le - Replace and paint 651,00



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

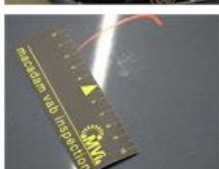

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Scratch(es), E - Replace

0,00

