


RENAULT Grand Scenic: 1GWM729

Vinnnumber:	VF1JZ14P650518186	Versionname:	GRAND SCENIC Energy Zen 7pl.110PK
First Registrationdate:	20/05/2014	Fiscalpower:	
Expertise Mileage:	81303	Power Kw:	81
Bodytype:	MPV	Body color	Light Brown
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	3620
Battery functioning	Yes		
Number of doors	5		
Number of seats	7		
Number head rests	7		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Sun Roof electric
GPS storage		Panoramic roof
GPS storage	SD	Central consol F
Windows electric F		Luggage cover
Windows electric R		Front parking sensors
Cruise Control		Rear parking sensors
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining semi-artificial leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/17/95 V LightMetal			
Summer tyres:	Fr.L.	Bridgestone: 6 mm	Fr.R.	Bridgestone: 6 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	593,20
Seat cover F L, Worn, Acceptable	0,00
<i>No pictures to display</i>	
Tailgate, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Bump(s), PDR - Knock out without painting	63,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Trunk lid covering R, Scratch(es), Smart repair 110,64



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Door frame F L, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display


Headlight L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Bump(s) and scratch(es), It - Spot repair 115,56

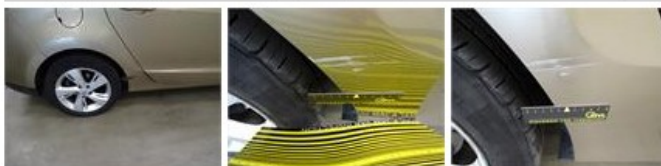

Door trim R R, Scratch(es), E - Replace 114,00



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display