



BMW X3: 1GFE054			
Vinnumber:	WBAWY110800C53526	Versionname:	X3 sDrive18 136PK Aut.
First Registrationdate:	22/01/2014	Fiscalpower:	
Expertise Mileage:	111525	Power Kw:	100
Bodytype:	Break	Body color:	Brown
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4426
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	HD Front parking sensors
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Seats F heated	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/60/17/99 H LightMetal			
Winter tyres:	Fr.L.	Bridgestone: 3 mm	Fr.R.	Bridgestone: 3 mm
	Re.L.	Bridgestone: 3 mm	Re.R.	Bridgestone: 3 mm

Assistance equipment	
Repair kit	Yes
Compressor	Yes
Total cost ex VAT	95,00
Wing F L, Bad repair, Paint	0,00



Door F L, Bad repair, Paint	0,00
-----------------------------	-------------



Bumper R, Bad repair, Paint 0,00



Rearview mirror L complete, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Bump(s), Acceptable 0,00

No pictures to display

Wing R L, Bad repair, Paint 0,00



Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Bump(s), Acceptable 0,00

No pictures to display


Backrest cover F R, Scratch(es), Acceptable 0,00

No pictures to display

Backrest cover F L, Scratch(es), Acceptable 0,00

No pictures to display


Bonnet, Bad repair, Paint 0,00

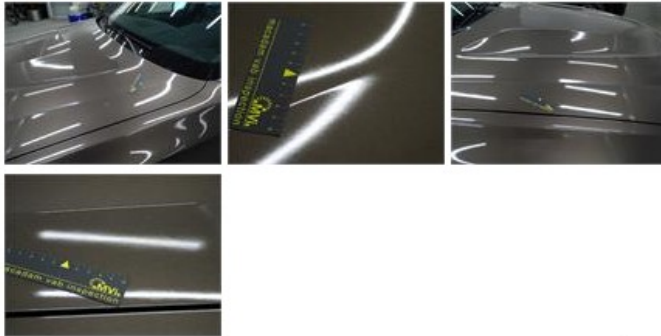

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

No pictures to display

Wing F R, Bad repair, Paint 0,00

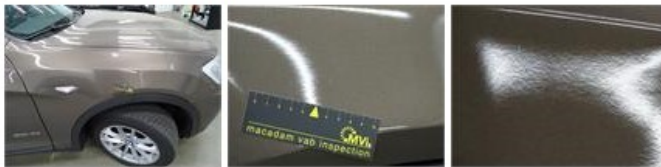

Door F R, Repaired, Acceptable 0,00

No pictures to display

Door R L, Repaired, Acceptable 0,00

No pictures to display