



BMW 3 BERLINE: 1KCB351			
Vinnumber:	WBA3D11020J856090	Versionname:	2.0 318D (100KW) BERLINE
First Registrationdate:	30/03/2015	Fiscalpower:	
Expertise Mileage:	178970	Power Kw:	100
Bodytype:	Transporter	Body color:	Silver
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2509
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		


Options	
Radio CD	Central consol F
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining artificial leather
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/60/16/92 V LightMetal			
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT		211,80	
Bumper R, Scratch(es), Acceptable		0,00	
<i>No pictures to display</i>			
Tailgate, Scratch(es), Acceptable		0,00	
<i>No pictures to display</i>			
Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete)		211,80	



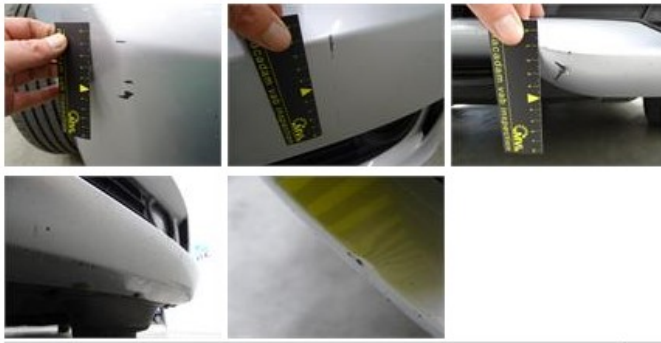

Windscreen, Repaired, Acceptable	0,00
<i>No pictures to display</i>	
Bonnet, Stone chip(s), Acceptable	0,00
<i>No pictures to display</i>	