



**AUDI A4: 1HCB321**

Vinnumber:	<b>WAUZZZ8KXEA153457</b>	Versionname:	<b>A4 AVANT TDie 136PK</b>
First Registrationdate:	<b>16/06/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>115178</b>	Power Kw:	<b>100</b>
Bodytype:	<b>Break</b>	Body color:	<b>Silver</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1331</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**


	<b>205/60/16/92 H LightMetal</b>			
Summer tyres:	Fr.L.	<b>Uniroyal: 5 mm</b>	Fr.R.	<b>Uniroyal: 5 mm</b>
	Re.L.	<b>Uniroyal: 6 mm</b>	Re.R.	<b>Uniroyal: 6 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-----------------------	------------	------	------------

Total cost ex VAT	<b>1719,00</b>
-------------------	----------------


Door R R, Bump(s), LI - Repair and paint (complete)	<b>318,35</b>
---	---------------

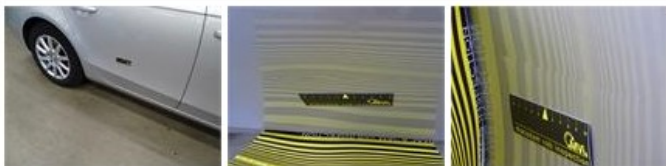

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	<b>95,00</b>
--	--------------



Bonnet, Bad repair, Acceptable	<b>0,00</b>
--------------------------------	-------------

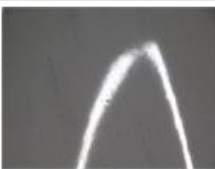

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Bump(s), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Door F L, Scratch(es), LI - Repair and paint (complete) 318,35



Sill outer R, Bump(s), LI - Repair and paint (complete) 310,50



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



SD card, Missing, E - Replace 275,00

No pictures to display