



## SKODA Superb: 1AXR443

Vinnnumber:	<b>TMBJJ73T0B9060116</b>	Versionname:	<b>SUPERB COMBI GreenLine Ambient.DPF 105PK</b>
First Registrationdate:	<b>13/04/2011</b>	Fiscalpower:	
Expertise Mileage:	<b>161100</b>	Power Kw:	<b>77</b>
Bodytype:	<b>Break</b>	Body color:	<b>Brown</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>4128</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

## Options

Radio CD		Seats electric F L	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	<b>Tow bar fixed</b>
Seats F heated			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

## Limited Technical Inspection

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

## Degree of wear

	<b>205/55/16/91 H LightMetal</b>			
Summer tyres:	Fr.L.	<b>Uniroyal: 6 mm</b>	Fr.R.	<b>Uniroyal: 6 mm</b>
	Re.L.	<b>Uniroyal: 8 mm</b>	Re.R.	<b>Uniroyal: 8 mm</b>

## Assistance equipment

Repair kit	<b>No</b>	Compressor	<b>No</b>
------------	-----------	------------	-----------

Total cost ex VAT 2689,93

Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 369,84



Interior, Dirty, Cleaning

50,00





Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Steering wheel, Worn, Acceptable 0,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 0,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16








Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Rearlight L, Damaged, E - Replace 132,00



Roof, Chemical pollution, LI - Repair and paint (complete) 0,00

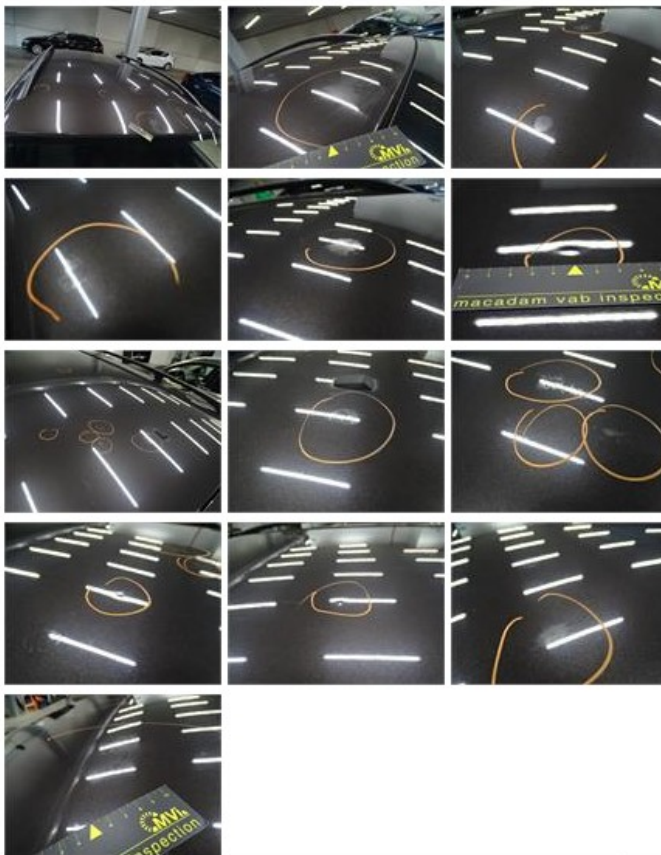


Tailgate, Rust, LI - Repair and paint (complete) 362,02





Bonnet, Chemical pollution, LI - Repair and paint (complete) 348,09

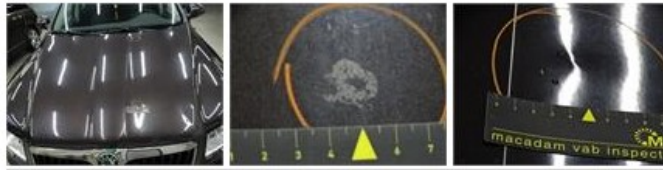

Door R L, Bump(s) and scratch(es), Le - Replace and paint 0,00



Sill outer R, Bump(s) and scratch(es), LI - Repair and paint (complete) 0,00



Door R R, Scratch(es), LI - Repair and paint (complete) 382,02



Front bumper, Scratch(es), LI - Repair and paint (complete) 254,16



Tyre repair kit, Missing, E - Replace 252,64

