


SKODA Superb: 1HBT762

Vinnumber:	TMBJJ73T4E9060088	Versionname:	SUPERB COMBI GreenLine Elegance 105PK
First Registrationdate:	13/06/2014	Fiscalpower:	
Expertise Mileage:	185999	Power Kw:	77
Bodytype:	Break	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	1214
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats R heated
GPS storage	HD	Seats electric F L
GPS storage		Seats electric F R
Windows electric F		Central consol F
Windows electric R		Luggage cover
Cruise Control		Front parking sensors
Steering wheel multifunctional		Rear parking sensors
Seats F heated		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Bridgestone: 3 mm	Re.R.	Bridgestone: 3 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	436,00
-------------------	--------

Door panel R L, Scratch(es), Acceptable	0,00
---	------

No pictures to display

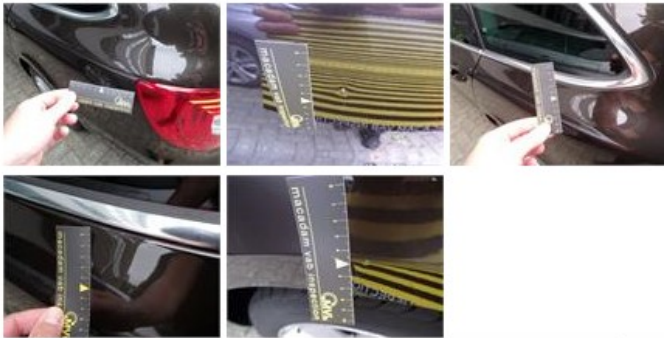





Tailgate, Bump(s), PDR - Knock out without painting	63,00
---	-------



Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door R R, Bump(s), Acceptable	0,00
-------------------------------	------

<i>No pictures to display</i>		
Alloy rim R R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Wing R L, Bump(s), PDR - Knock out without painting		63,00
		
Door F R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Rearlight L, Crack, E - Replace		132,00
		
Rear wiper arm, Missing, E - Replace		20,00
		
Wing F L, Bad repair, Acceptable		0,00
		
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)		95,00
		
Wing R R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Rear spoiler, Bump(s), PDR - Knock out without painting		63,00
		
MOT Certificate, Incomplete, P - Check		0,00
<i>No pictures to display</i>		