



VOLKSWAGEN Passat: 1CXG811			
Vinnnumber:	WVWZZZ3CZCE553425	Versionname:	PASSAT CC BMT 136PK
First Registrationdate:	19/03/2012	Fiscalpower:	
Expertise Mileage:	146008	Power Kw:	100
Bodytype:		Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2724
Number of doors	4		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options	
Radio CD	Central consol F
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Seats F heated	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	NOT OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
Winter tyres:	235/45/17/94 H LightMetal			
	Fr.L.	Uniroyal: 7 mm	Fr.R.	Uniroyal: 7 mm
	Re.L.	Kleber: 5 mm	Re.R.	Kleber: 5 mm

Assistance equipment	
Repair kit	No
Compressor	No
Total cost ex VAT	1628,28
Alloy rim R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	---------------




Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08

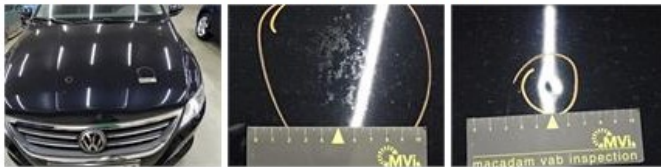

Tyre repair kit, Missing, E - Replace 220,00

No pictures to display

Backrest cover F L, Worn, Acceptable 0,00

