



BMW 2 COUPE: AC8705			
Vinnnumber:	WBA2G71000VZ10081	Versionname:	2.0 220D (135 KW)
First Registrationdate:	8/01/2015	Fiscalpower:	
Expertise Mileage:	86189	Power Kw:	140
Bodytype:		Body color:	Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3710
Number of doors:	2		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		


Options	
Radio CD	Central consol F
Windows electric F	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining leather
Type of climate control:	Autom climate control
Sport seats	

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	NOT OK
		Wiperblades	OK

Degree of wear				
	225/40/18/88 Y LightMetal			
Summer tyres:	Fr.L.	Bridgestone: 7 mm	Fr.R.	Bridgestone: 7 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm

Assistance equipment			
Repair kit	No	Compressor	No

Total cost ex VAT	763,48
Bonnet, Bad repair, Acceptable	0,00

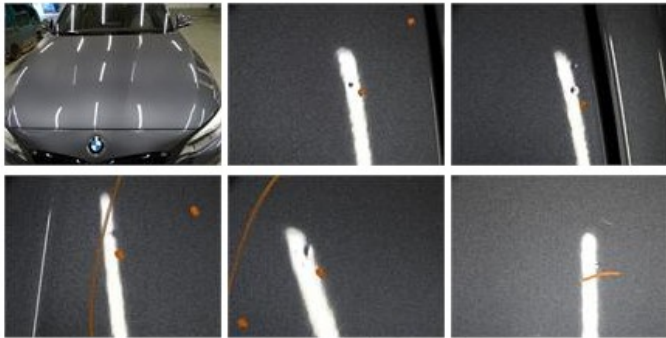



Tyre repair kit, Missing, E - Replace	250,00
---------------------------------------	--------

No pictures to display

Door F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Tailgate, Bump(s) and scratch(es), LI - Repair and paint (complete)	301,68
---	--------



Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display