



**AUDI A3: 1HJS019**

Vinnnumber:	<b>WAUZZ8V3FA022253</b>	Versionname:	<b>A3 SB Attraction 110PK</b>
First Registrationdate:	<b>4/08/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>69087</b>	Power Kw:	<b>81</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Dark Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3112</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Sun Roof electric	
Windows electric F	Central consol F	
Windows electric R	Luggage cover	
Steering wheel multifunctional	Rear parking sensors	
Seats F heated	Type of Tow bar	<b>Tow bar fixed</b>
Radio multimedia		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining leather</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>


**Degree of wear**

	<b>205/55/16/91 T LightMetal</b>			
Winter tyres:	Fr.L.	<b>Bridgestone: 5 mm</b>	Fr.R.	<b>Bridgestone: 5 mm</b>
	Re.L.	<b>Bridgestone: 5 mm</b>	Re.R.	<b>Bridgestone: 5 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Total cost ex VAT			<b>907,38</b>
Rearview mirror housing L, Scratch(es), Acceptable			<b>0,00</b>
<i>No pictures to display</i>			
Wing R R, Scratch(es), Acceptable			<b>0,00</b>
<i>No pictures to display</i>			
Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete)			<b>211,80</b>




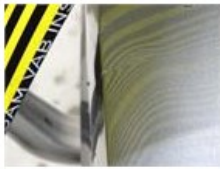

Roof, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 290,08

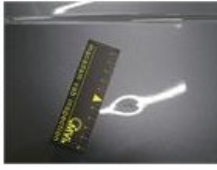

Wing F R, Bad repair, Acceptable 0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Sill outer R, Bump(s), LI - Repair and paint (complete) 310,50

