



MINI Mini: 1 SFK033

Vinnnumber:	WMWZR71060T351558	Versionname:	MINI CABRIO Cooper SD
First Registrationdate:	6/03/2013	Fiscalpower:	136PK DPF
Expertise Mileage:	159722	Power Kw:	100
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2512
Number of doors:	2		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
Windows electric F		Rear parking sensors	
Windows electric R			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS portable		
Type of Lining	Lining leather		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


	195/55/16/87 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 1768,64

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80

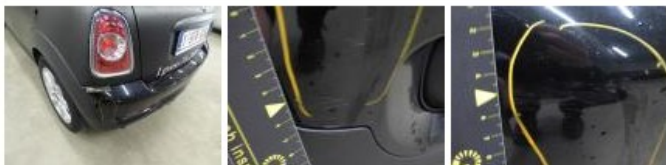

Door panel F L, Broken, E - Replace

114,00



Ignition key, Not functioning (well), P - Check 0,00

No pictures to display

Front bumper, Damaged, LI - Repair and paint (complete) 211,80



Grill, Damaged, E - Replace 92,52



Rearview mirror housing L, Damaged, LI - Repair and paint (complete) 115,56



Bonnet, Damaged, LI - Repair and paint (complete) 290,08

No pictures to display

Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Headrest R R, Missing, E - Replace 60,00



Door F R, Bump(s), PDR - Knock out without painting 63,00



Windscreen trim, Unclassed, N - Mount/Dismount 0,00

No pictures to display

Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20



Bodywork, Not original part, Acceptable

0,00

No pictures to display