


RENAULT Grand Scenic: 1GSN960

| | | | |
|------------------------------------|--------------------------|--------------|---|
| Vinnnumber: | VF1JZ14M650809695 | Versionname: | GRAND SCENIC Energy Life Spl.110PK |
| First Registrationdate: | 16/04/2014 | Fiscalpower: | |
| Expertise Mileage: | 126391 | Power Kw: | 81 |
| Bodytype: | Hatchback | Body color: | Grey |
| Gearbox: | MAN 6 VIT | Paint type: | Metalic |
| Transmission: | | Rims summer: | Steel |
| Fueltype: | Diesel | Oil level: | OK |
| Battery functioning: | Yes | Parking lot: | 2120 |
| Number of doors: | 5 | | |
| Number of seats: | 5 | | |
| Number head rests: | 5 | | |
| Rims summer: | Steel | | |
| Category: | Passenger Car | | |
| Oil level: | OK | | |
| Registration Certificate Car (BE): | Yes | | |

Options

| | |
|--------------------------------|-------------------------------|
| Radio CD | Central consol F |
| Windows electric F | Luggage cover |
| Windows electric R | |
| Cruise Control | |
| Steering wheel multifunctional | |
| Radio multimedia | |
| Type of headlighting | Headlighting Halogen |
| Type of GPS | GPS big screen color |
| Type of Lining | Lining fabrics |
| Type of climate control | Manual climate control |

Limited Technical Inspection

| | | | |
|---------------------|-----------|---------------------|------------|
| Airco functioning | OK | Battery functioning | Yes |
| Tires wear profile | OK | Power steering | Yes |
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Wiper fluid level | OK |
| Handbrake | OK | Transmission | OK |
| | | Lighting | OK |
| | | Wiperblades | OK |

Degree of wear

| | | | | |
|---------------|-----------------------------|-----------------------|-------|-----------------------|
| | 205/60/16/96 H Steel | | | |
| Summer tyres: | Fr.L. | Michelin: 4 mm | Fr.R. | Michelin: 4 mm |
| | Re.L. | Michelin: 5 mm | Re.R. | Michelin: 5 mm |

Assistance equipment

| | | | |
|-------------|------------|------|------------|
| Spare wheel | Yes | Jack | Yes |
|-------------|------------|------|------------|

| | |
|--|---------|
| Total cost ex VAT | 2068,96 |
| Wheel cover F R, Scratch(es), Acceptable | 0,00 |
| <i>No pictures to display</i> | |
| Wheel cover R L, Missing, E - Replace | 30,00 |



| | |
|---|--------|
| Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) | 318,35 |
|---|--------|



Wheel cover R R, Missing, E - Replace 30,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display


Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80



Roof, Bump(s), LI - Repair and paint (complete) 481,50

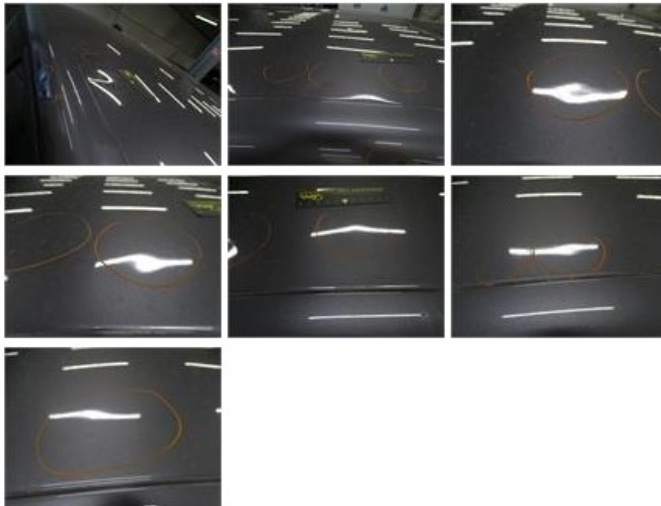

Roof pillar R, Bump(s), Acceptable 0,00

No pictures to display

Rocker panel inner R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 115,56



Interior, Dirty, Cleaning 0,00





Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35



Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80



Ignition key, Missing, E - Replace 150,00

No pictures to display

Bonnet, Bump(s), PDR - Knock out without painting 201,60

