



VOLVO V60: 1EWR391			
Vinnumber:	YV1FW84A1D1135085	Versionname:	V60 D2 Kinetic St/St 115PK
First Registrationdate:	9/04/2013	Fiscalpower:	
Expertise Mileage:	151022	Power Kw:	84
Bodytype:	Break	Body color:	Dark Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3111
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control


Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
Summer tyres:	205/60/16/92 H LightMetal			
	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			957,85
Front bumper, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Roof, Chemical polution, LI - Repair and paint (complete)			481,50



Door F R, Chemical polution, LI - Repair and paint (complete)			318,35
---	--	--	---------------

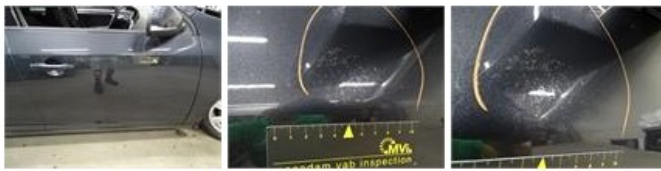

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Roof pillar R, Chemical pollution, Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Bump(s), PDR - Knock out without painting 63,00

