



AUDI A1: 1FJR777

Vinnnumber:	WAUZZZ8X9EB012059	Versionname:	A1 5B Attraction 90PK
First Registrationdate:	18/07/2013	Fiscalpower:	
Expertise Mileage:	84690	Power Kw:	66
Bodytype:	Hatchback	Body color:	Silver
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2433
Number of doors:	5		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Luggage cover	
GPS storage	SD	Rear parking sensors	
GPS storage			
Windows electric F			
Windows electric R			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/15/88 V LightMetal			
Summer tyres:	Fr.L.	Continental: 1,6 mm	Fr.R.	Continental: 1,6 mm
	Re.L.	Kleber: 5 mm	Re.R.	Kleber: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1160,70
-------------------	----------------

Front bumper, Scratch(es), LI - Repair and paint (complete)	169,44
---	---------------






Ignition key, Missing, E - Replace 150,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 385,20

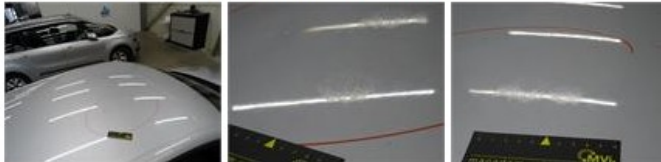

Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L polished, Rust, Acceptable 0,00

No pictures to display

Tailgate, Bump(s), Acceptable 0,00

No pictures to display

Interior, Stain, Cleaning 75,00



Tyre F R, Tear, Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 232,06



Bumper grille F R, Broken, E - Replace 149,00



Alloy rim F R polished, Scratch(es), Acceptable 0,00

No pictures to display