



LAND ROVER Range: 48816

Vinnnumber:	SALLSAAG6DA789570	Versionname:	RANGE ROVER SP.Sdv6 Autob.+Des.256PK Aut
First Registrationdate:	1/01/2020	Fiscalpower:	
Expertise Mileage:	36715	Power Kw:	188
Bodytype:	Off-road	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4221
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Seats electric F L	
Windows electric F		Seats electric F R	
Windows electric R		Sun Roof electric	
Cruise Control		Central consol F	
Steering wheel multifunction		Luggage cover	
Seats F heated		Rear parking sensors	
Radio multimedia		Type of Tow bar	Tow bar removable
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Level control			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


	275/40/20/106 Y LightMetal			
Summer tyres:	Fr.L.	Michelin: 7 mm	Fr.R.	Michelin: 7 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Jack	Yes
------	------------

Total cost ex VAT	2330,68
--------------------------	----------------

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------

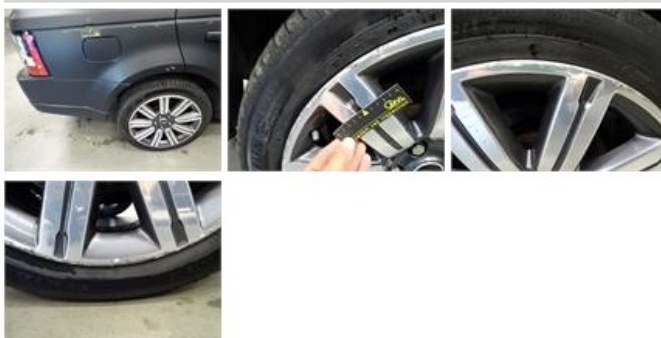

Bumper R, Scratch(es), LI - Repair and paint (complete)	254,16
--	---------------




Roof, Chemical pollution, LI - Repair and paint (complete)

577,80



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00

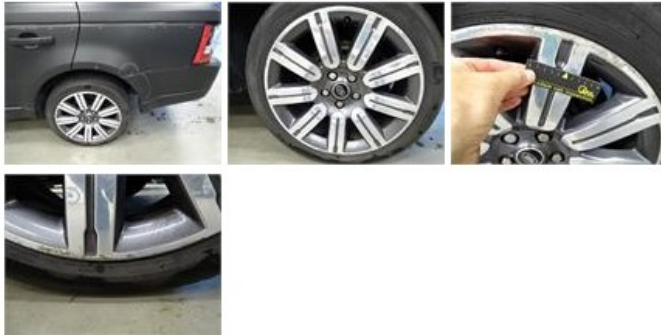

Alloy rim F R polished, Scratch(es), E - Replace

277,44



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)

369,84



Alloy rim F L polished, Scratch(es), E - Replace

277,44



Bodywork, Not original part, Remove lettering

384,00

