



RENAULT Grand Scenic: 1HBX201

Vinnnumber:	VF1JZ14P650054593	Versionname:	GRAND SCENIC Energy R-Movie 7pl.110PK
First Registrationdate:	13/06/2014	Fiscalpower:	
Expertise Mileage:	167361	Power Kw:	81
Bodytype:		Body color	Grey
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	4625
Battery functioning	Yes		
Number of doors	5		
Number of seats	7		
Number head rests	7		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Central consol F	
TV/DVD screen R		Luggage cover	
GPS storage		Front parking sensors	
GPS storage	SD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/50/17/95 H LightMetal			
Winter tyres:	Fr.L.	Kleber: 4 mm	Fr.R.	Kleber: 4 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm




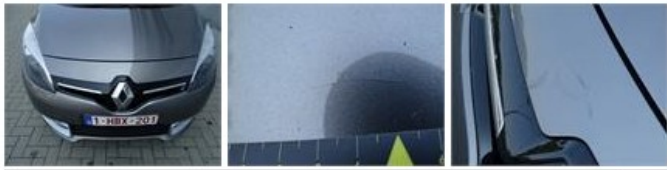




Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	935,00
Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--------------------------------------------------------------	-------

	Wing R L, Scratch(es), LI - Repair and paint (complete)	308,20
	Door F L, Bump(s), PDR - Knock out without painting	142,20
	Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete)	211,80
	Seat cover F L, Worn, Acceptable	0,00
	Door F R, Bump(s), Acceptable	0,00
<i>No pictures to display</i>		
Door panel R L, Deformed, P - Check		
	Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
Door panel R R, Deformed, P - Check		
	Wing R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Door R L, Bump(s), PDR - Knock out without painting	82,80