


**AUDI A3: 1GIV545**

Vinnumber:	<b>WAUZZZ8V2EA138428</b>	Versionname:	<b>A3 SB Ambition 5-line</b>
First Registrationdate:	<b>19/02/2014</b>	Fiscalpower:	<b>136PK</b>
Expertise Mileage:	<b>87299</b>	Power Kw:	<b>100</b>
Bodytype:		Body color	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level	<b>OK</b>
Maintenance	<b>OK</b>	Parking lot	<b>2807</b>
Battery functioning	<b>Yes</b>		
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Rims summer	<b>Aluminium</b>		
Category	<b>Passenger Car</b>		
Oil level	<b>OK</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>SD</b>	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>No Tow bar</b>
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>225/40/18/92 Y LightMetal</b>			
Summer tyres:	Fr.L.	<b>Continental: 4 mm</b>	Fr.R.	<b>Continental: 4 mm</b>
	Re.L.	<b>Continental: 5 mm</b>	Re.R.	<b>Continental: 5 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	3048,21
-------------------	---------

Rear spoiler, Scratch(es), Acceptable	0,00
---------------------------------------	------

*No pictures to display*

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)	115,56
--	--------



Ignition key, Missing, E - Replace	150,00
------------------------------------	--------



Alloy rim F L, Damaged, E - Replace

235,20



Wing R R, Rust, LI - Repair and paint (complete)

308,20




Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Roof, Bump(s) and scratch(es), LI - Repair and paint (complete)

481,50

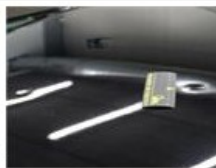

Door R L, Bump(s), PDR - Knock out without painting

63,00



Wing R L, Bump(s), PDR - Knock out without painting

63,00



Front bumper, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim F R, Damaged, E - Replace

235,20



Rearlight R , Scratch(es), 67 - Polish 0,00



Alloy rim R L, Damaged, E - Replace 235,20



Tyre R L, Damaged, E - Replace 132,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R, Damaged, E - Replace 235,20



Tyre F L, Flat, E - Replace 132,00

No pictures to display

Tyre F R, Flat, E - Replace 132,00

No pictures to display