


AUDI A3: 1HHD250

Vinnnumber:	WAUZZZ8V9EA184354	Versionname:	A3 SB Ultra Attraction
First Registrationdate:	22/07/2014	Fiscalpower:	110PK
Expertise Mileage:	133991	Power Kw:	81
Bodytype:		Body color	Blue
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	3724
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	872,26
-------------------	--------

Sill outer L, Scratch(es), Acceptable	0,00
---------------------------------------	------

No pictures to display

Interior, Stain, Cleaning	25,00
---------------------------	-------




Bumper corner R L, Scratch(es), It - Spot repair	115,56
--	--------



Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), LI - Repair and paint (complete) 318,35

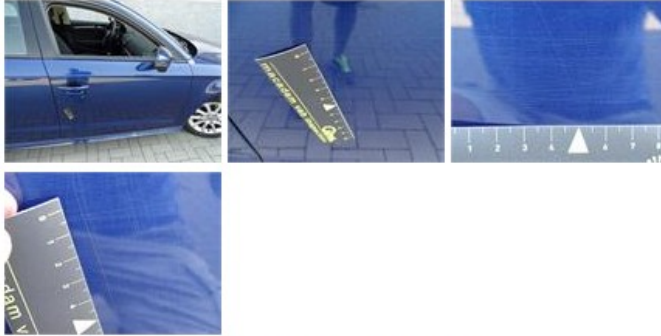

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Ignition key, Missing, E - Replace 0,00

No pictures to display

Bumper R, Difference in color, Acceptable 0,00



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35

