



<b>RENAULT Clio: 1GVY038</b>			
Vinnnumber:	<b>VF15RJLOH50895030</b>	Versionname:	<b>CLIO IV BER e-Expression St&amp;St 90PK</b>
First Registrationdate:	<b>15/05/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>124246</b>	Power Kw:	<b>66</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Light Grey</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2829</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>4</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

<b>Options</b>			
Windows electric F		Luggage cover	
Cruise Control		Type of Tow bar	<b>No Tow bar</b>
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Manual climate control</b>		

<b>Limited Technical Inspection</b>			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

<b>Degree of wear</b>				
	<b>185/65/15/88 T Steel</b>			
Summer tyres:	Fr.L.	<b>Michelin: 4 mm</b>	Fr.R.	<b>Michelin: 4 mm</b>
	Re.L.	<b>Bridgestone: 5 mm</b>	Re.R.	<b>Bridgestone: 5 mm</b>

<b>Assistance equipment</b>			
Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>

<b>Total cost ex VAT</b>	<b>1321,66</b>
<b>Bumper R, Scratch(es), LI - Repair and paint (complete)</b>	<b>169,44</b>




<b>Wing R R, Scratch(es), LI - Repair and paint (complete)</b>	<b>246,56</b>
--	---------------



Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F L, Bump(s) and scratch(es), LI - Repair and paint (complete) 115,56

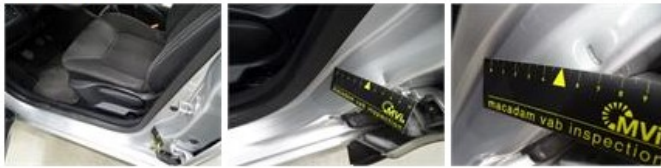

Rocker panel inner F R, Scratch(es), Acceptable 0,00

No pictures to display


Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R R, Scratch(es), E - Replace 24,00





Roof, Bump(s) and scratch(es), LI - Repair and paint (complete) 385,20

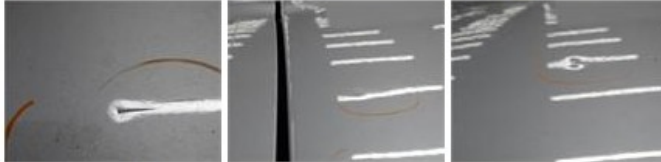

Wheel cover F R, Scratch(es), E - Replace 24,00



Tailgate, Scratch(es), LI - Repair and paint (complete) 241,34

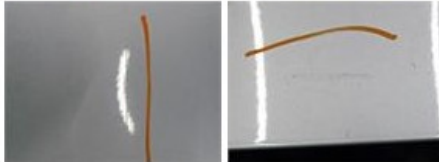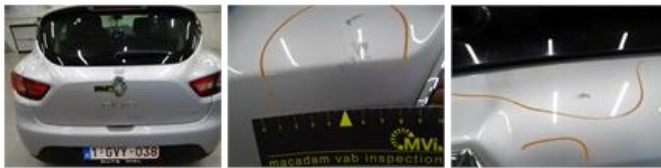

Rocker panel inner R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 115,56



Windscreen, Stone chip(s), Acceptable

0,00

*No pictures to display*