



AUDI A3: 1FKB638			
Vinnumber:	<b>WAUZZZ8V3EA018119</b>	Versionname:	<b>A3 SB Ambition S-line 105PK</b>
First Registrationdate:	<b>23/07/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>172518</b>	Power Kw:	<b>77</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>White</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3113</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining semi-leather</b>
Type of climate control	<b>Autom climate control</b>
Sport seats	

Limited Technical Inspection			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>NOT OK</b>
		Wiperblades	<b>OK</b>

Degree of wear				
	<b>225/40/18/92 Y LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Continental: 4 mm</b>	Re.R.	<b>Continental: 4 mm</b>


Assistance equipment			
Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Total cost ex VAT			2036,13
Alloy rim R R polished, Damaged, LI - Repair and paint (complete)			95,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20
---	--------




Roof, Dent(s), PDR - Knock out without painting 82,80

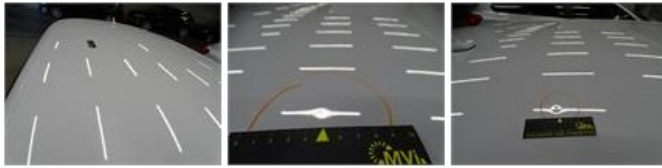

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80

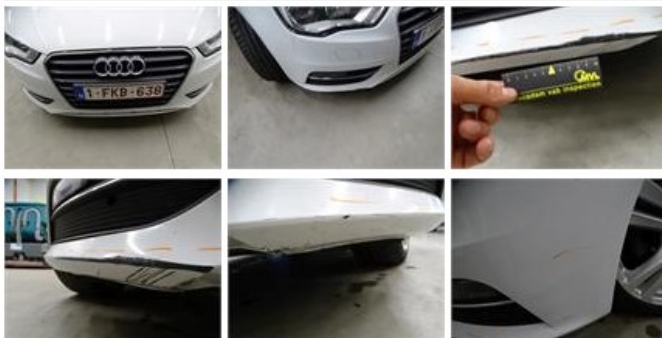

Alloy rim F R polished, Damaged, LI - Repair and paint (complete) 95,00



Luggage space cover, Damaged, E - Replace 240,00



Bonnet, Dent(s), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Door F R, Dent(s), PDR - Knock out without painting 63,00



Alloy rim F L polished, Damaged, LI - Repair and paint (complete) 95,00



Alloy rim R L polished, Damaged, LI - Repair and paint (complete) 95,00



Wing F L, Scratch(es), LI - Repair and paint (complete) 220,18

