



AUDI A4: 1GRR663

Vinnumber:	WAUZZZ8K4EA107090	Versionname:	A4 BER TDie 136PK
First Registrationdate:	10/04/2014	Fiscalpower:	
Expertise Mileage:	193911	Power Kw:	100
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2822
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
GPS storage	Rear parking sensors
GPS storage	CD
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/96 W LightMetal			
Summer tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Yokohama: 4 mm	Re.R.	Vredestein: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	596,32
Grill frame, Broken, E - Replace	69,00



Seat cover F R, Stain, Cleaning	25,00
---------------------------------	-------



Door R R, Repaired, P - Check

0,00



Wing R L, Repaired, No repair

0,00




Wing F R, Repaired, No repair

0,00



Bumper R, Scratch(es), 67 - Polish

0,00

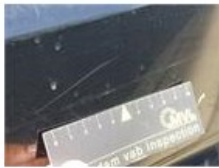

Wing R R, Dent(s), Acceptable

0,00



Door R L, Scratch(es), Acceptable

0,00



Door F L, Dent(s) and scratch(es), Acceptable

0,00



Rear bulkhead lining, Scratch(es), Smart repair

110,64



Door R L, Repaired, P - Check 0,00



Wing R L, Rust, It - Spot repair 115,56



Door F R, Repaired, P - Check 0,00



Door F L, Repaired, P - Check 0,00



Floor covering F R, Burned, Smart repair 64,32



Front bumper, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80

