



BMW X3: 1FLW978			
Vinnumber:	WBAWY110800C57138	Versionname:	X3 sDrive18 136PK
First Registrationdate:	12/08/2013	Fiscalpower:	
Expertise Mileage:	115170	Power Kw:	100
Bodytype:	SUV	Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2303
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunction		Type of Tow bar	No Tow bar
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/60/17/99 Y LightMetal			
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			2801,95
Door F L, Scratch(es), LI - Repair and paint (complete)			382,02




Bumper R, Scratch(es), Smart repair	110,64
-------------------------------------	---------------



Door F R, Scratch(es), LI - Repair and paint (complete) 382,02



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

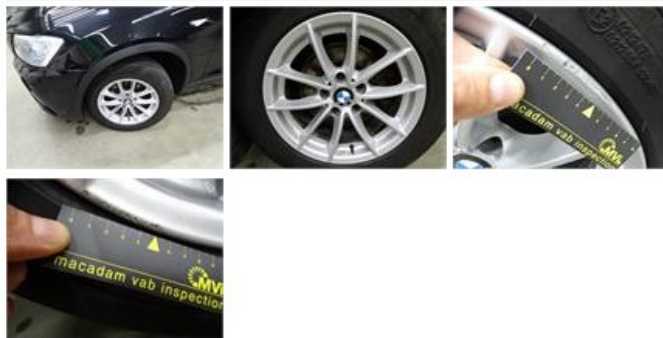

Roof, Chemical polution, LI - Repair and paint (complete) 577,80



Door R L, Scratch(es), LI - Repair and paint (complete) 382,02



Rocker panel inner R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Backrest cover R L - Damaged, F - Replace 44,00




Front bumper, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,16



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Bad repair, Acceptable 0,00

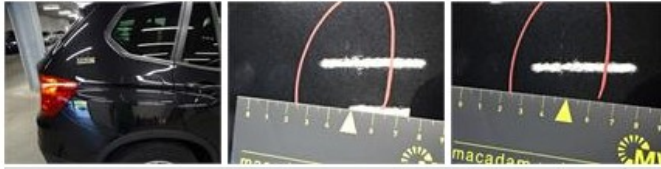

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Front bumper, Scratch(es), Smart repair 110,64



Bonnet, Chemical pollution, LI - Repair and paint (complete) 348,09

