



FORD Fiesta: 1EXK926	
Vinnnumber:	WF0DXXGAKDDM85049
First Registrationdate:	15/04/2013
Expertise Mileage:	119565
Bodytype:	Hatchback
Gearbox:	MAN 5 VIT
Transmission:	
Fueltype:	Diesel
Battery functioning	Yes
Number of doors	5
Number of seats	5
Number head rests	4
Rims summer	Aluminium
Category	Passenger Car
Oil level	OK
Versionname:	FIESTA BER Titanium ECONetic S/S 95PK
Fiscalpower:	
Power Kw:	70
Body color	Grey
Paint type	Metalic
Rims summer	Aluminium
Oil level	OK
Parking lot	2314

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Steering wheel multifunctional	Rear parking sensors
Type of headlighting	Type of Tow bar
Type of GPS	No Tow bar
Type of Lining	
Type of climate control	
Headlighting Halogen	
GPS big screen color	
Lining fabrics	
Autom climate control	

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	175/65/14/82 T LightMetal			
Winter tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 6 mm

Assistance equipment	
Emergency spare wheel	Yes

Total cost ex VAT	5544,39
Front bumper, Scratch(es), LI - Repair and paint (complete)	169,44




Door F L, Dent(s) and scratch(es), Le - Replace and paint	894,81
--	--------



Rear window, Scratch(es), E - Replace	320,00
--	--------



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete) 248,40

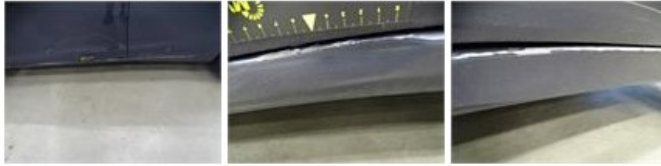

Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00




Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,68



Door R R, Dent(s) and scratch(es), Le - Replace and paint 786,33

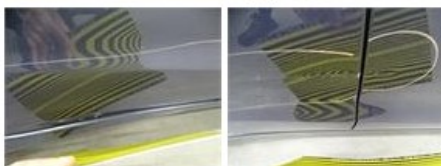

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 169,44





Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,68



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

176,14



Roof, Chemical polution, LI - Repair and paint (complete)

529,20



Bonnet, Chemical polution, LI - Repair and paint (complete)

328,06



Wing R R, Dent(s) and scratch(es), Le - Replace and paint 1033,21

