



**OPEL Insignia: 1FJG062**

Vinnumber:	<b>WOLGM6EJ7D1120383</b>	Versionname:	<b>INSIGNIA BER ecoFL.Edition S/S 110PK</b>
First Registrationdate:	<b>15/07/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>110374</b>	Power Kw:	<b>81</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2533</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining leather</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>245/45/18/100 V LightMetal</b>			
Summer tyres:	Fr.L.	<b>Bridgestone: 7 mm</b>	Fr.R.	<b>Bridgestone: 7 mm</b>
	Re.L.	<b>Michelin: 6 mm</b>	Re.R.	<b>Michelin: 6 mm</b>

**Assistance equipment**


Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-----------------------	------------	------	------------


Total cost ex VAT	1434,55
-------------------	---------

Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

*No pictures to display*

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------

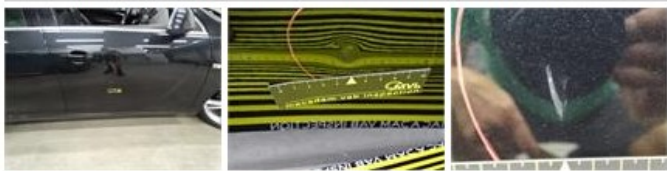

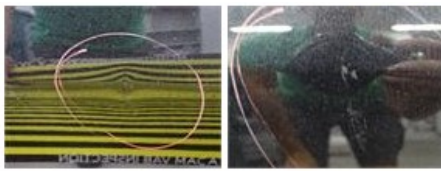

Door F L, Scratch(es), LI - Repair and paint (complete) 318,35



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete) 310,50



Protection plate M, Tear, E - Replace 74,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Scratch(es), LI - Repair and paint (complete) 318,35

