



<b>BMW 2: 9942</b>			
Vinnnumber:	<b>WBA1H11090V260592</b>	Versionname:	<b>2 COUPE 220dA 184PK Aut.</b>
First Registrationdate:	<b>1/01/2020</b>	Fiscalpower:	
Expertise Mileage:	<b>109118</b>	Power Kw:	<b>135</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2714</b>
Number of doors:	<b>3</b>		
Number of seats:	<b>4</b>		
Number head rests:	<b>4</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

<b>Options</b>			
Radio CD		Central consol F	
Windows electric F		Rear parking sensors	
Cruise Control		Type of Tow bar	<b>No Tow bar</b>
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		
Sport seats			

<b>Limited Technical Inspection</b>			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

<b>Degree of wear</b>				
Summer tyres:	<b>225/45/17/91 W LightMetal</b>			
	Fr.L.	<b>Bridgestone: 3 mm</b>	Fr.R.	<b>Bridgestone: 3 mm</b>
	Re.L.	<b>Bridgestone: 4 mm</b>	Re.R.	<b>Bridgestone: 4 mm</b>

<b>Assistance equipment</b>			
Repair kit	<b>No</b>	Compressor	<b>No</b>
Total cost ex VAT			<b>1575,68</b>
Alloy rim F L polished, Scratch(es), Acceptable			<b>0,00</b>
<i>No pictures to display</i>			
Tailgate, Chemical polution, LI - Repair and paint (complete)			<b>301,68</b>



Wing R.L. Dent(s) and scratch(es), LI - Repair and paint (complete)			<b>308,20</b>
---	--	--	---------------

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 300,00



Tyre repair kit, Missing, E - Replace 210,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Wing R R, Scratch(es), Acceptable 0,00


No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Dent(s), PDR - Knock out without painting 142,20



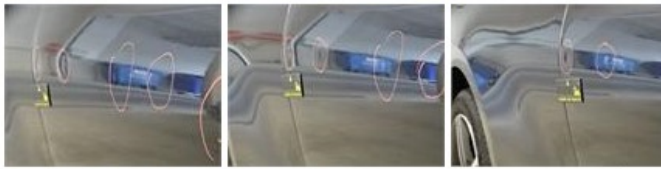

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00

