




BMW X1: MW7394			
Vinnumber:	WBAVP71050VW63914	Versionname:	X1 xDrive18 143PK
First Registrationdate:	7/05/2013	Fiscalpower:	
Expertise Mileage:	110753	Power Kw:	105
Bodytype:	SUV	Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3533
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control


Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	NOT OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/50/17/94 H Steel			
Summer tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Bridgestone: 7 mm	Re.R.	Bridgestone: 7 mm

Assistance equipment	
Repair kit	Yes
Compressor	Yes
Total cost ex VAT	2268,70
Wheel cover R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wheel cover F L, Damaged, E - Replace	30,00

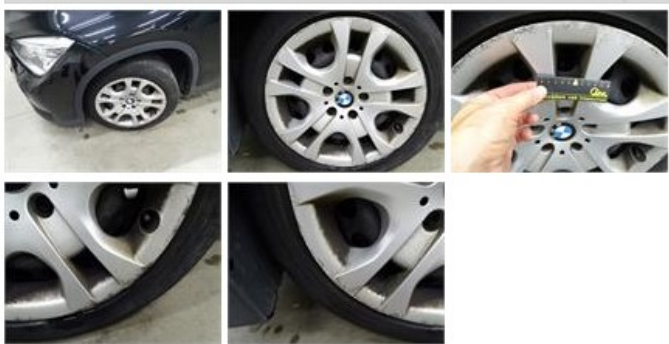

Windscreen, Damaged, E - Replace	487,20
----------------------------------	---------------

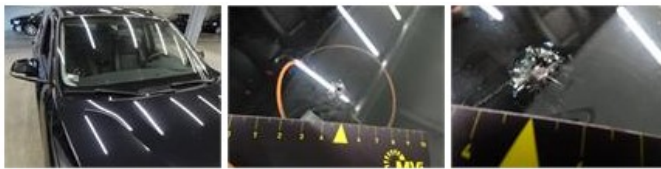

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Wheel cover R R, Damaged, E - Replace 30,00



Floor covering F L, Hole, E - Replace 252,00



Front bumper, Scratch(es), It - Spot repair 115,56



Wheel cover F R, Damaged, E - Replace 30,00



Roof, Scratch(es), LI - Repair and paint (complete) 481,50





Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Dent(s) and scratch(es), Smart repair 110,64



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display