



VOLKSWAGEN CC: 1GUK492

Vinnumber:	WVWZZZ3CZEE536182	Versionname:	CC BMT 136PK
First Registrationdate:	5/05/2014	Fiscalpower:	
Expertise Mileage:	135613	Power Kw:	100
Bodytype:		Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3602
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Seats F heated	
Radio multimedia	
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining leather and alcantara
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/40/18/95 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	811,98
-------------------	--------

Roof, Stone chip(s), Acceptable	0,00
---------------------------------	------

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------





Wing F R, Dent(s), Acceptable 0,00

No pictures to display

Door R R, Bad repair, Acceptable 0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display


Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

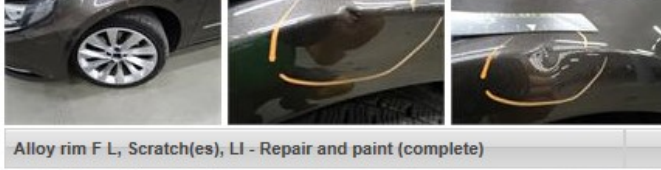

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00

