


RENAULT Grand Scenic: 1FKL055

Vinnumber:	VF1JZ14M649518506	Versionname:	GRAND SCENIC Expression
First Registrationdate:	26/07/2013	Fiscalpower:	5pl.110PK
Expertise Mileage:	178088	Power Kw:	81
Bodytype:	Hatchback	Body color:	Red
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3326
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F	
Windows electric F	Rear parking sensors	
Windows electric R	Type of Tow bar	No Tow bar
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 V Steel			
Summer tyres:	Fr.L.	Firestone: 6 mm	Fr.R.	Firestone: 6 mm
	Re.L.	Firestone: 6 mm	Re.R.	Firestone: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1616,80
-------------------	----------------

Bumper moulding F L, Missing, E - Replace	14,40
---	--------------





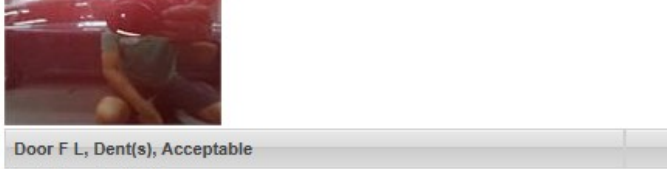
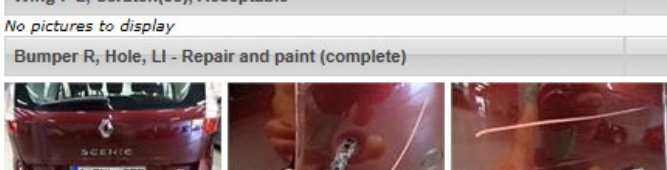
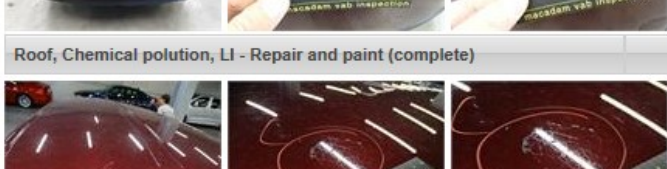

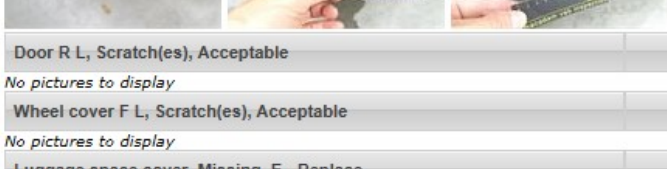




Tailgate, Dent(s), Acceptable	0,00
-------------------------------	-------------

No pictures to display

Wing R L, Dent(s), Acceptable	0,00
-------------------------------	-------------

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	---------------

	Door F R, Scratch(es), LI - Repair and paint (complete)	318,35
	Door F L, Dent(s), Acceptable	0,00
<i>No pictures to display</i>		
	Wing F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Bumper R, Hole, LI - Repair and paint (complete)	211,80
	Roof, Chemical pollution, LI - Repair and paint (complete)	481,50
	Front bumper, Dent(s) and scratch(es), Le - Replace and paint	0,00
	Door R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Wheel cover F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Luggage space cover, Missing, E - Replace	240,00
	Wing R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Bumper grille F L, Crack, E - Replace	32,40