



TOYOTA Grand Prius Plus: 1GSY241

Vinnnumber:	JTDZ53EU903059965	Versionname:	GRAND PRIUS+ Hybrid Comfort 99PK Aut.
First Registrationdate:	22/04/2014	Fiscalpower:	
Expertise Mileage:	122394	Power Kw:	73
Bodytype:	MPV	Body color:	Grey
Gearbox:	Automatic	Body color:	.
Transmission:	Front	Paint type:	Metalic
Fueltype:	Hybrid	Rims summer:	Steel
Battery functioning:	Yes	Oil level:	OK
Number of doors:	5	Parking lot:	3127
Number of seats:	7		
Number head rests:	7		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	No		

Options

Radio CD		Seats electric F L
GPS storage	HD	Panoramic roof
GPS storage		Central consol F
Windows electric F		Luggage cover
Windows electric R		Front parking sensors
Cruise Control		Rear parking sensors
Steering wheel multifunctional		
Type of headlighting	Headlighting Halogen	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	
Head-up Display		
Level control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 V Steel			
Summer tyres:	Fr.L.	Uniroyal: 7 mm	Fr.R.	Uniroyal: 7 mm
	Re.L.	Yokohama: 4 mm	Re.R.	Yokohama: 4 mm

Assistance equipment




















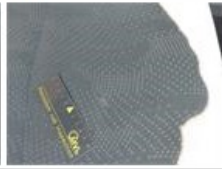


Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 2607,60

Bumper R, Scratch(es), LI - Repair and paint (complete) 169,44



Seat cover F L, Hole, E - Replace 312,00

			Wheel cover R R, Scratch(es), E - Replace	24,00
			Front bumper, Dent(s) and scratch(es), Le - Replace and paint	607,20
				
			Wheel cover F R, Scratch(es), E - Replace	24,00
			Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	272,14
				
			Wheel cover F L, Scratch(es), E - Replace	24,00
			Seat cover R L, Hole, E - Replace	312,00
			Seat cover F R, Hole, E - Replace	312,00
			Wheel cover R L, Scratch(es), E - Replace	24,00
			Door F R, Bad repair, LI - Repair and paint (complete)	254,68



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

272,14

