


**HYUNDAI i30: 1GWM678**

Vinnnumber:	<b>TMAD381UAEJ060433</b>	Versionname:	<b>i30 WAGON Blue Drive 110PK</b>
First Registrationdate:	<b>20/05/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>100677</b>	Power Kw:	<b>81</b>
Bodytype:		Body color:	<b>Brown</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3505</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Rear parking sensors	
Cruise Control	Type of Tow bar	<b>Tow bar fixed</b>
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>195/65/15/91 T LightMetal</b>			
Winter tyres:	Fr.L.	<b>Michelin: 6 mm</b>	Fr.R.	<b>Michelin: 6 mm</b>
	Re.L.	<b>Michelin: 6 mm</b>	Re.R.	<b>Michelin: 6 mm</b>

**Assistance equipment**


Total cost ex VAT	3703,00
Rear spoiler, Bad repair, Acceptable	0,00




Door R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)	211,80



Floor covering F L, Hole, E - Replace 252,00

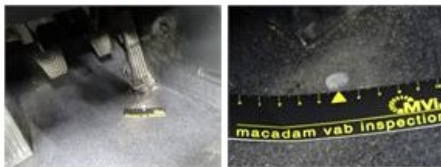

Tailgate, Bad repair, Acceptable 0,00

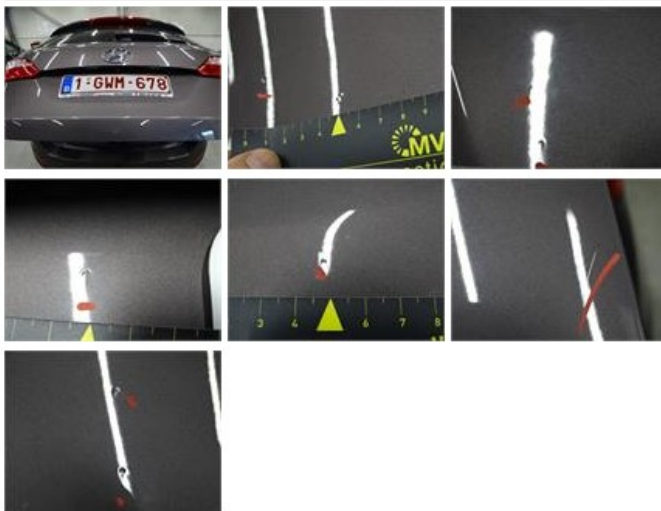

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Luggage space cover, Missing, E - Replace 240,00



Front bumper, Broken, Le - Replace and paint 735,00



Door R R, Bad repair, Acceptable 0,00



Roof pillar R, Dent(s), Acceptable 0,00

No pictures to display

Headlight L, Broken, E - Replace 396,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Deformed / Strained, Le - Replace and paint 1016,70



Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Rear window, Scratch(es), E - Replace 370,00



Rearview mirror housing L, Bad repair, Acceptable 0,00

