

AUDI A5: 1HFB576			
Vinnumber:	<b>WAUZZZ8TXFA004945</b>	Versionname:	<b>A5 SB Ultra 136PK</b>
First Registrationdate:	<b>4/07/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>130672</b>	Power Kw:	<b>100</b>
Bodytype:		Body color:	<b>Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3724</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

Options	
Radio CD	Central consol F
GPS storage	HD Luggage cover
GPS storage	Front parking sensors
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining leather</b>
Type of climate control	<b>Autom climate control</b>

Limited Technical Inspection			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

Degree of wear				
Summer tyres:	<b>225/50/17/94 Y LightMetal</b>			
	Fr.L.	<b>Continental: 5 mm</b>	Fr.R.	<b>Continental: 5 mm</b>
	Re.L.	<b>Continental: 7 mm</b>	Re.R.	<b>Continental: 7 mm</b>

Assistance equipment			
Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Total cost ex VAT			<b>807,64</b>
Trunk lid covering R, Hole, E - Replace			<b>25,00</b>




Trunk lid covering R, Scratch(es), Smart repair			<b>110,64</b>
---	--	--	---------------



Door R R, Dent(s), Acceptable	0,00
-------------------------------	------

*No pictures to display*

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)	302,16
---	--------

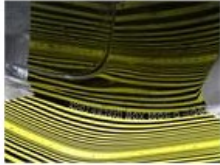

Wing R L, Dent(s), LI - Repair and paint (complete)	369,84
---	--------



Front bumper, Scratch(es), Acceptable	0,00
---------------------------------------	------

*No pictures to display*

Door F L, Dent(s), Acceptable	0,00
-------------------------------	------

*No pictures to display*