



VOLKSWAGEN Golf: 1GHT267

Vinnumber:	WVWZZZAUZEP559573	Versionname:	GOLF VAR Trendline 105PK
First Registrationdate:	11/02/2014	Fiscalpower:	
Expertise Mileage:	67670	Power Kw:	77
Bodytype:		Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4619
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Central consol F
GPS storage	SD	Luggage cover
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting:	Headlighting Halogen	
Type of GPS:	GPS big screen color	
Type of Lining:	Lining fabrics	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/91 V Steel			
Summer tyres:	Fr.L.	Firestone: 6 mm	Fr.R.	Firestone: 6 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	2237,50
Rearlight L, Broken, E - Replace	114,00



Ignition key, Missing, E - Replace	150,00
------------------------------------	--------

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Wheel cover F R, Missing, E - Replace 30,00



Wing F R, Dent(s), PDR - Knock out without painting 63,00



Door F L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner R R, Scratch(es), Acceptable 0,00

No pictures to display

Mirror side blinker L, Broken, E - Replace 30,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Scratch(es), E - Replace 487,20



Roof, Dent(s), PDR - Knock out without painting 82,80



Door F R, Dent(s), Acceptable 0,00

No pictures to display

Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete) 406,50



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80





Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Door R R, Dent(s), Acceptable 0,00

No pictures to display

Wing R L, Dent(s), LI - Repair and paint (complete) 308,20

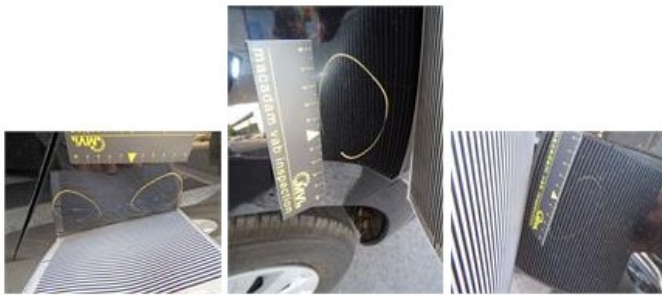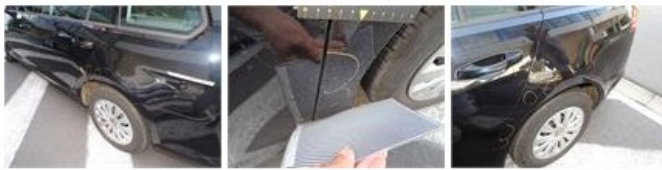

Tailgate, Dent(s), PDR - Knock out without painting 142,20

