



PEUGEOT 308 SW ACCES 92PK: 1HFT547

Vinnumber:	VF3LC9HPAES149652	Versionname:	
First Registrationdate:	9/07/2014	Fiscalpower:	
Expertise Mileage:	151281	Power Kw:	68
Bodytype:		Body color:	Silver
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
Windows electric F			
Cruise Control			
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/91 V Steel			
Summer tyres:	Fr.L.	Other: 6 mm	Fr.R.	Other: 6 mm
	Re.L.	Other: 6 mm	Re.R.	Other: 6 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT

1982,46

Tailgate, Scratch(es), LI - Repair and paint (complete)

301,68



Door F L, Dent(s), Acceptable

0,00



Door F R, Dent(s), Acceptable 0,00



Engine, Not functioning (well), P - Check 0,00



Wheel cover R R, Scratch(es), E - Replace 30,00



Door F L, Dent(s), PDR - Knock out without painting 63,00



Seat cover F L, Burned, Smart repair 64,32



Front bumper, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Sill outer R, Dent(s), LI - Repair and paint (complete) 310,50



Wing R R, Dent(s), LI - Repair and paint (complete) 308,20





Wing F R, Scratch(es), Acceptable 0,00



Wing F L, Scratch(es), Acceptable 0,00



Wheel cover F R, Scratch(es), E - Replace 30,00



Seat cover R L, Burned, Smart repair 64,32




Wheel cover F L, Scratch(es), E - Replace 30,00



Door R R, Dent(s), PDR - Knock out without painting 63,00



Floor covering F L, Burned, E - Replace 252,00

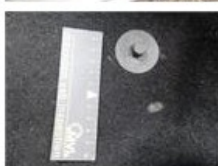

Wing R L, Dent(s), Acceptable 0,00



Wing R L, Dent(s), PDR - Knock out without painting 63,00




Wheel cover R L, Scratch(es), E - Replace 30,00



Interior, Dirty, Cleaning 50,00



Bumper R, Scratch(es), Acceptable 0,00

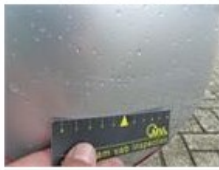

Covering interior front pillar L, Burned, Smart repair 110,64

