



KIA Sportage: 1FMR194			
Vinnnumber:	U5YPC815ADL360195	Versionname:	SPORTAGE 2WD Sense+ ISG EcoDyn.115PK
First Registrationdate:	21/08/2013	Fiscalpower:	
Expertise Mileage:	97876	Power Kw:	85
Bodytype:	SUV	Body color	Dark Grey
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2102
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/60/17/99 H LightMetal			
Summer tyres:	Fr.L.	Hankook: 4 mm	Fr.R.	Hankook: 4 mm
	Re.L.	Hankook: 7 mm	Re.R.	Hankook: 7 mm


Assistance equipment			
Spare wheel	Yes	Jack	Yes
Total cost ex VAT			2514,43
Tailgate, Dent(s), LI - Repair and paint (complete)			301,68



Bumper corner R L, Scratch(es), It - Spot repair	115,56
---	---------------




Front bumper, Dent(s) and scratch(es), Le - Replace and paint 735,00

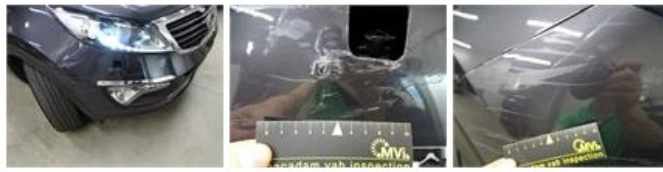

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

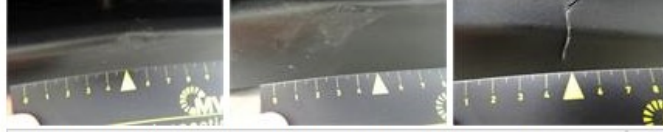

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35




Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56

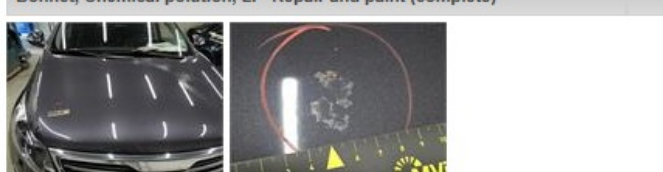


Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56

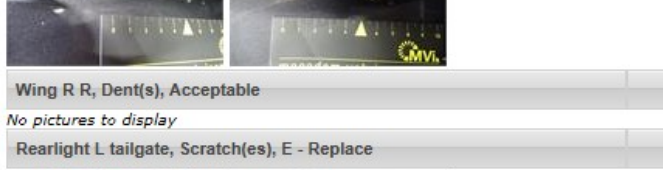

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Rearlight L tailgate, Scratch(es), E - Replace 114,00



Sill outer R, Dent(s) and scratch(es), Le - Replace and paint

298,00



Alloy rim F R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), Smart repair

110,64



Wing F R, Dent(s), Acceptable

0,00

No pictures to display