


**FORD Focus: 1HTD544**

Vinnnumber:	<b>WFOKXXGCBKEP55323</b>	Versionname:	<b>FOCUS BER ECONetic Trend 88g 105PK</b>
First Registrationdate:	<b>26/09/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>175182</b>	Power Kw:	<b>77</b>
Bodytype:		Body color	<b>Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level	<b>OK</b>
Battery functioning	<b>Yes</b>	Parking lot	<b>2627</b>
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Rims summer	<b>Steel</b>		
Category	<b>Passenger Car</b>		
Oil level	<b>OK</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

**Options**

Radio CD		Luggage cover	
GPS storage		Front parking sensors	
GPS storage	<b>HD</b>	Rear parking sensors	
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>205/55/16/91 V Steel</b>			
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>

**Assistance equipment**




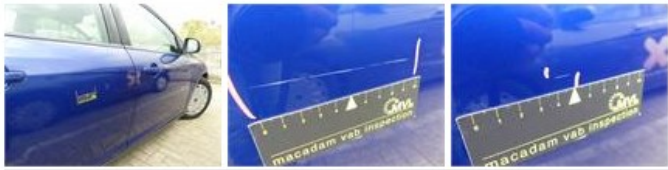






Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-----------------------	------------	------	------------

Total cost ex VAT	791,02
-------------------	--------

Wing F R, Repaired, No repair	0,00
-------------------------------	------



Door R L, Scratch(es), 67 - Polish	0,00
------------------------------------	------

	Floor covering F R, Burned, Smart repair	64,32
	Door F R, Repaired, P - Check	0,00
	Door R R, Scratch(es), LI - Repair and paint (complete)	318,35
	Bumper R, Scratch(es), Acceptable	0,00
	Wheel cover R R, Scratch(es), E - Replace	30,00
	Wing R R, Repaired, No repair	0,00
	Wheel cover F L, Scratch(es), E - Replace	30,00
	Wheel cover F R, Scratch(es), E - Replace	30,00
	Wing R R, Scratch(es), Acceptable	0,00
	Door F R, Scratch(es), LI - Repair and paint (complete)	318,35



Bonnet, Repaired, No repair 0,00



Door R R, Repaired, P - Check 0,00



Door F L, Scratch(es), Acceptable 0,00

