



HYUNDAI i40: 1FLN164			
Vinnnumber:	KMHLB81UADU062510	Versionname:	i40 BRE Lounge ISG 115PK
First Registrationdate:	7/08/2013	Fiscalpower:	
Expertise Mileage:	131813	Power Kw:	85
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2810
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/60/16/92 H LightMetal			
Summer tyres:	Fr.L.	Goodyear: 6 mm	Fr.R.	Goodyear: 6 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm

Assistance equipment			
Emergency spare wheel	Yes	Jack	Yes


Total cost ex VAT	1154,35
Front bumper, Deformed / Strained, LI - Repair and paint (complete)	211,80



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35

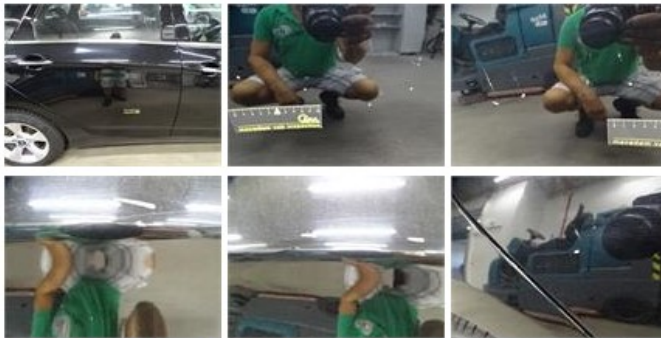

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper grille, Dent(s), E - Replace 32,40



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00





Bonnet, Scratch(es), Acceptable

0,00

No pictures to display