



NISSAN Qashqai: 1ELD773			
Vinnumber:	SJNFCAJ10U2653474	Versionname:	QASHQAI 2WD Tekna+Nis.Connect DPF 110PK
First Registrationdate:	11/01/2013	Expertise Mileage:	183629
Bodytype:	SUV	Fiscalpower:	81
Gearbox:	MAN 6 VIT	Power Kw:	81
Transmission:		Body color:	Grey
Fueltype:	Diesel	Paint type:	Metalic
Battery functioning:	Yes	Rims summer:	Aluminium
Number of doors:	5	Oil level:	OK
Number of seats:	5	Parking lot:	4329
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	215/60/17/96 V LightMetal			
Summer tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes

Total cost ex VAT	1408,74
Door frame F R, Scratch(es), It - Spot repair	115,56




Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)	301,68
---	---------------



Bumper F L, Scratch(es), Acceptable	0,00
-------------------------------------	-------------

Bonnet, Bad repair, Acceptable 0,00

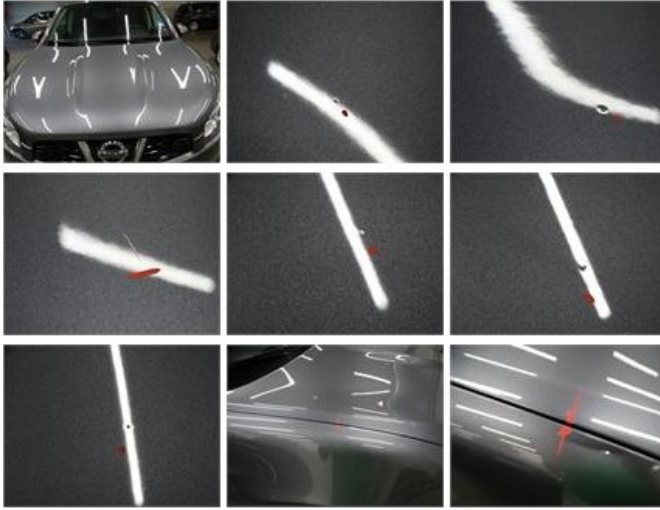

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Door R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover R, Damaged, E - Replace 360,00



Ignition key, Missing, E - Replace 150,00

No pictures to display

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display