



PEUGEOT 208: 1EMW214			
Vinnnumber:	VF3CC8HR0CW117117	Versionname:	208 BER Active 68PK
First Registrationdate:	25/01/2013	Fiscalpower:	
Expertise Mileage:	138942	Power Kw:	50
Bodytype:	Hatchback	Body color:	Silver
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1233
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options	
Windows electric F	Luggage cover
Cruise Control	
Steering wheel multifunction	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	185/65/15/88 T Steel			
Summer tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Uniroyal: 4 mm	Re.R.	Uniroyal: 4 mm

Assistance equipment			
Emergency spare wheel	Yes	Jack	Yes

Total cost ex VAT	4117,74
Roof pillar R, Hail damage, Le - Replace and paint	980,56



Door F R, Dent(s), PDR - Knock out without painting	201,60
-----------------------------------------------------	---------------



Bonnet, Hail damage, Le - Replace and paint 827,76



Sill outer R, Dent(s), LI - Repair and paint (complete) 248,40



Roof, Hail damage, Forfeit hail (heavy) 769,20



Wing R L, Hail damage, LI - Repair and paint (complete) 246,56



Rearview mirror housing R, Crack, E - Replace 84,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display


Rear spoiler, Hail damage, LI - Repair and paint (complete) 115,56



Wing R R, Hail damage, LI - Repair and paint (complete) 246,56



Door R R, Dent(s), PDR - Knock out without painting 221,40

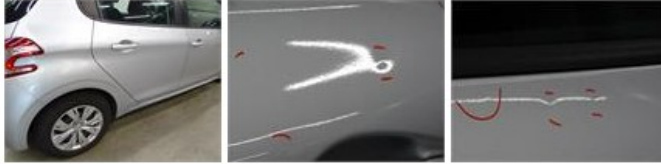

Roof pillar L, Hail damage, LI - Repair and paint (complete) 176,14

