


SKODA Octavia: 1HFX256

Vinnnumber:	TMBAG9NE1F0026835	Versionname:	OCTAVIA BER Ambition
First Registrationdate:	10/07/2014	Fiscalpower:	105PK
Expertise Mileage:	182992	Power Kw:	77
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3226
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining fabrics
Type of climate control:	Autom climate control
Adaptive cruise control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 V LightMetal			
Summer tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm

Assistance equipment


Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	2930,82
-------------------	---------

Tailgate, Dent(s), LI - Repair and paint (complete)	301,68
---	--------



Roof, Chemical pollution, LI - Repair and paint (complete)	481,50
--	--------

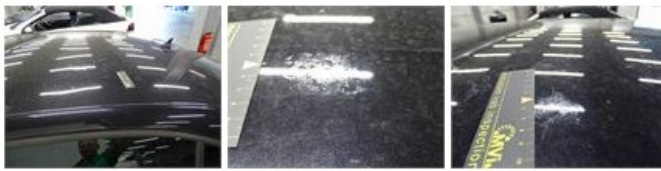



Wing R R, Bad repair, Acceptable

0,00



Door R L, Scratch(es), LI - Repair and paint (complete)

318,35

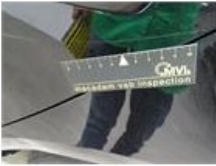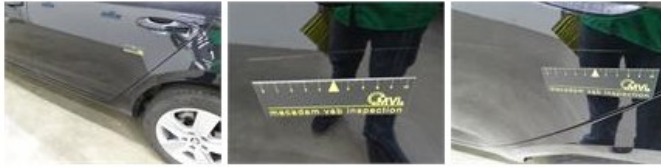


Front bumper, Scratch(es), LI - Repair and paint (complete)

211,80



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

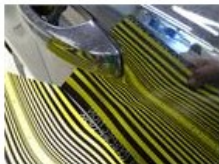


Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Bonnet, Dent(s), LI - Repair and paint (complete)

290,08

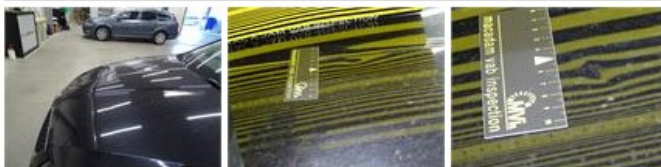

Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20



Door F R, Dent(s), RDR - Knock out without painting

63,00

Door F R, Dent(s), PDR - Knock out without painting 65,00



Outer door handle F R, Scratch(es), LI - Repair and paint (complete) 115,56



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete) 310,50

