


AUDI A3: 1HTE279

Vinnnumber:	WAUZZZ8V7EA199810	Versionname:	A3 SB Attraction 105PK
First Registrationdate:	26/09/2014	Fiscalpower:	
Expertise Mileage:	115099	Power Kw:	77
Bodytype:	Hatchback	Body color:	Dark Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3501
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Rear parking sensors	
Cruise Control	Type of Tow bar	Tow bar fixed
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm


Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1427,37
Wing R L, Dent(s), Acceptable			0,00
<i>No pictures to display</i>			
Boot carpet, Dirty, Cleaning			25,00


Seat cover R L, Hole, Smart repair
64,32



Roof, Dent(s), LI - Repair and paint (complete) 481,50

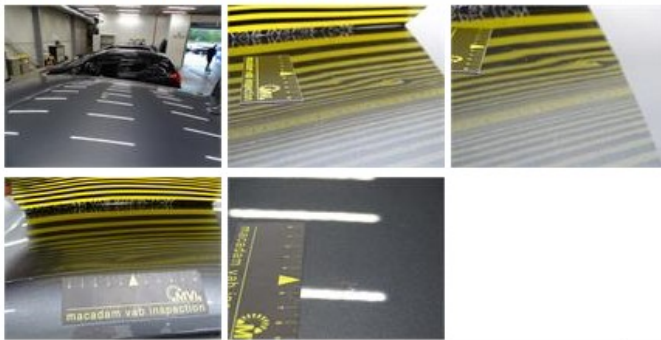

Ignition key, Missing, E - Replace 150,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20



Luggage space cover, Missing, E - Replace 80,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Bad repair, Acceptable 0,00

