



AUDI Q5: JA8748

Vinnumber:	WAUZZZ8R2FA087016	Versionname:	2.0 TDI 130KW QUATTRO
First Registrationdate:	13/01/2015	Fiscalpower:	
Expertise Mileage:	180062	Power Kw:	130
Bodytype:	SUV	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1214
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Front parking sensors	
Cruise Control	Rear parking sensors	
Steering wheel multifunction	Type of Tow bar	No Tow bar
Seats F heated		
Radio multimedia		
Type of headlighting	Headlighting Xenon	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	235/65/17/104 W LightMetal			
Summer tyres:	Fr.L.	Goodyear: 2 mm	Fr.R.	Goodyear: 2 mm
	Re.L.	Goodyear: 2 mm	Re.R.	Goodyear: 2 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1438,04
Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)			382,02

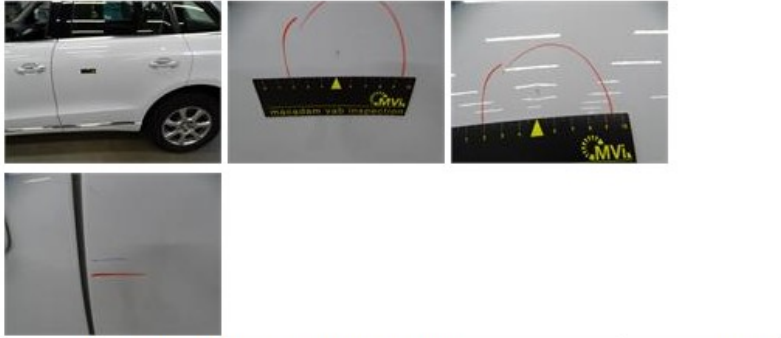

Bumper R, Scratch(es), LI - Repair and paint (complete)	254,16
--	---------------



Front bumper, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rocker panel inner F L, Dent(s), LI - Repair and paint (complete)	115,56



Protection plate M, Tear, E - Replace	74,00
---------------------------------------	-------



Wing F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	264,21



Wing R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bonnet, Scratch(es), LI - Repair and paint (complete)	348,09

