



BMW 5 TOURING: 1LTN746

Vinnumber:	WBA5L31020G084954	Versionname:	2.0 520D (120KW) TOURING
First Registrationdate:	1/12/2015	Fiscalpower:	
Expertise Mileage:	90229	Power Kw:	120
Bodytype:		Body color:	Brown
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3626
Battery functioning:	Yes		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/55/17/97 Y LightMetal			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 2216,36


Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16



Door R L, Scratch(es), LI - Repair and paint (complete) 382,02



Wing R L, Dent(s), PDR - Knock out without painting 63,00

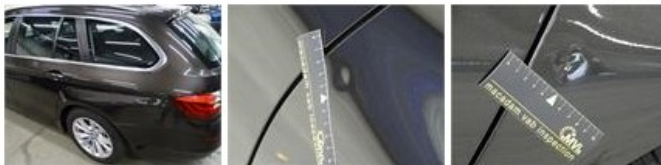

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Rearlight L, Damaged, E - Replace 132,00



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), E - Replace 420,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete) 372,60



Bumper F L, Scratch(es), It - Spot repair 115,56



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display