


PEUGEOT 308: 1FKK572

Vinnnumber:	VF34H9HP0DS145137	Versionname:	308 SW Active 92PK
First Registrationdate:	26/07/2013	Fiscalpower:	
Expertise Mileage:	111726	Power Kw:	68
Bodytype:		Body color:	Blue
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3327
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Panoramic roof	
GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm


Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	807,00
Door R L, Deformed / Strained, Acceptable	0,00
<i>No pictures to display</i>	
Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80



Interior, Stain, Cleaning	50,00
---------------------------	--------------

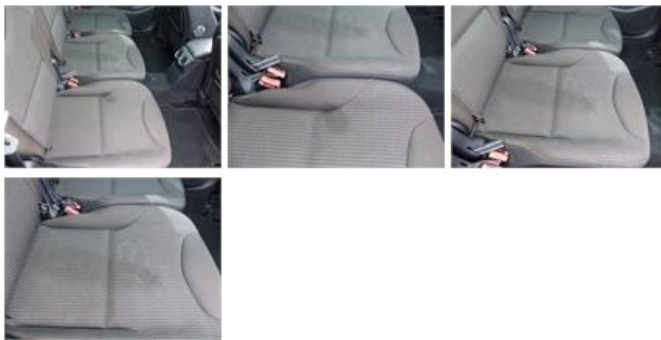

Bumper R, Bad repair, Acceptable	0,00
----------------------------------	------



Wing R L, Dent(s), Acceptable	0,00
-------------------------------	------

No pictures to display

Seat cover F L, Worn, Acceptable	0,00
----------------------------------	------

No pictures to display

Alloy rim F L, Scratch(es), Acceptable	0,00
--	------



Door F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door trim R R, Deformed / Strained, E - Replace	114,00
---	--------



Roof, Dent(s), PDR - Knock out without painting	241,20
---	--------



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------

