



VOLKSWAGEN Passat: 1GSI294

Vinnnumber:	WVWZZ3CZEE129857	Versionname:	PASSAT VAR Comfortline BMT 105PK
First Registrationdate:	15/04/2014	Fiscalpower:	
Expertise Mileage:	125876	Power Kw:	77
Bodytype:		Body color:	Gold
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3323
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/55/16/93 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1298,98
-------------------	----------------


Rearview mirror housing L, Scratch(es), Smart repair	110,64
--	---------------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	---------------



Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bonnet, Stone chip(s), Acceptable	0,00
<i>No pictures to display</i>	
Interior, Dirty, Acceptable	0,00

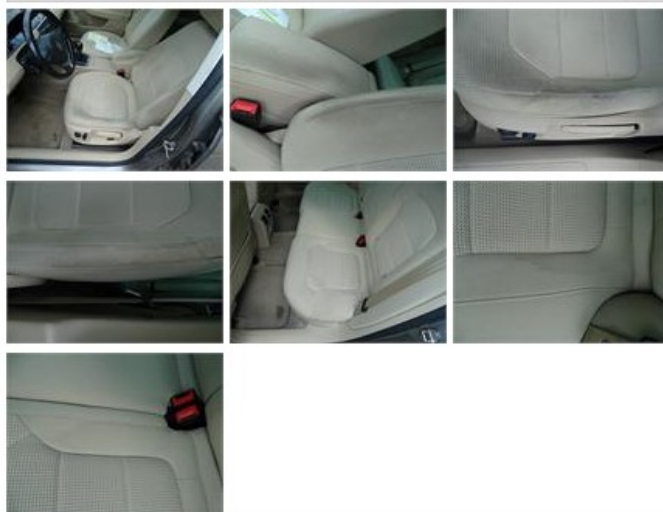

Windscreen, Stone chip(s), Windscreen repair	58,80
--	-------



Door R L, Dent(s), PDR - Knock out without painting	178,80
---	--------



Wing R L, Scratch(es), LI - Repair and paint (complete)	308,20
---	--------



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	220,18
---	--------



Rear spoiler, Dent(s) and scratch(es), LI - Repair and paint (complete)	115,56
---	--------



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display