



RENAULT Megane: 1EXN326			
Vinnumber:	VF1KZ1A0748909356	Versionname:	MEGANE GT TomTom Edition 90PK
First Registrationdate:	15/04/2013	Fiscalpower:	
Expertise Mileage:	130037	Power Kw:	66
Bodytype:	Break	Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2528
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	Tow bar fixed
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		








Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear				
Summer tyres:	195/65/15/91 H Steel			
	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment			
Spare wheel	Yes	Jack	Yes
Total cost ex VAT			1527,00
Wheel cover F L, Scratch(es), E - Replace			30,00
<i>No pictures to display</i>			
Wheel cover F R, Deformed / Strained, E - Replace			30,00



Protection plate M, Tear, E - Replace			74,00
---------------------------------------	--	--	--------------

Protection plate m, Rear, E - Replace		74,00
		
Bodywork, Not original part, Acceptable		0,00
No pictures to display		
Bumper F, Scratch(es), LI - Repair and paint (complete)		211,80
		
Bumper corner R L, Scratch(es), It - Spot repair		115,56
		
Bumper R, Dent(s) and scratch(es), Smart repair		110,64
		
Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)		301,68
		
Door moulding Lower F L, Missing, E - Replace		114,00
		
Wheel cover R R, Scratch(es), Acceptable		0,00
No pictures to display		
Wing F L, Scratch(es), Acceptable		0,00
		
Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)		115,56

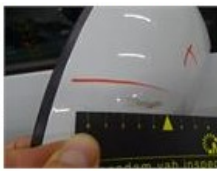

Wing R L, Scratch(es), LI - Repair and paint (complete) 308,20



Bumper corner R R, Dent(s) and scratch(es), It - Spot repair 115,56

