



VOLKSWAGEN Caddy: 1DFS528

Vinnumber:	WV1ZZZ2KZCX146349	Versionname:	CADDY VAN B/F 75PK
First Registrationdate:	7/05/2012	Fiscalpower:	
Expertise Mileage:	97089	Power Kw:	55
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4324
Battery functioning:	Yes		
Number of doors:	4		
Number of seats:	2		
Number head rests:	2		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	No		

Options

Radio CD	
Windows electric F	
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining semi-artificial leather
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/91 H Steel			
Summer tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	864,79
-------------------	--------

Bodywork, Not original part, Remove lettering	0,00
---	------

No pictures to display

Wing F L, Dent(s), Acceptable	0,00
-------------------------------	------

No pictures to display

Steel rim F L, Scratch(es), Acceptable	0,00
--	------



Wing R L, Rust, LI - Repair and paint (complete)	231,15
--	--------



Sliding door R, Dent(s), Acceptable 0,00

No pictures to display

Steel rim R L, Scratch(es), Acceptable 0,00



Steel rim F R, Scratch(es), Acceptable 0,00



Bumper F M, Dent(s) and scratch(es), Smart repair 110,64




Trunk door R L, Dent(s), PDR - Knock out without painting 63,00



Rear wiper arm, Incomplete, E - Replace 10,00



Seat cover F L, Burned, E - Replace 300,00

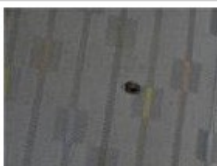

Registration Document, Missing, E - Replace 150,00



Steel rim R R, Scratch(es), Acceptable 0,00

