



VOLKSWAGEN TOURAN: 1JUV169

Vinnnumber:	WVGZZ1TZFW053491	Versionname:	1.6 CR TDI TRENDLINE BLUEMOTION TECH
First Registrationdate:	3/03/2015	Fiscalpower:	
Expertise Mileage:	124097	Power Kw:	77
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4824
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage		Luggage cover
GPS storage	HD	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2911,88
-------------------	---------

Seat cover F L, Stain, Acceptable	0,00
-----------------------------------	------

No pictures to display

Door panel R L, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Rearview mirror housing L, Broken, E - Replace	0,00
--	------




Bumper F, Broken, Le - Replace and paint	735,00
--	--------



Mirror side blinker R, Broken, E - Replace 30,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

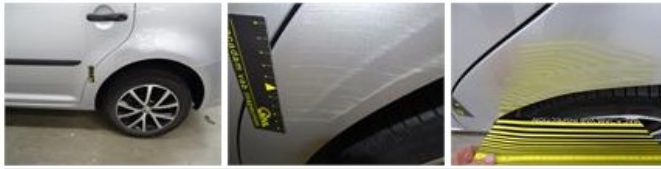

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (partial) 0,00



Wing F R, Dent(s) and scratch(es), Le - Replace and paint 530,02



Trunk lid covering R, Scratch(es), Acceptable 0,00



Bonnet, Dent(s), Acceptable 0,00

Headlight R, Crack, E - Replace 396,00

No pictures to display

No pictures to display


No pictures to display



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror glass L, Broken, E - Replace 18,00

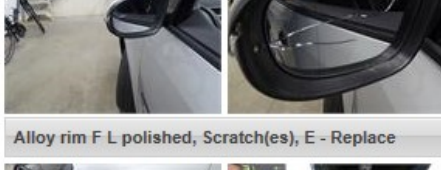

Alloy rim F L polished, Scratch(es), E - Replace 235,20



Mirror side blinker L, Broken, E - Replace 30,00



Alloy rim F R polished, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Dent(s), It - Spot repair 115,56



Bumper grille, Broken, E - Replace 32,40



Seat cover R R, Stain, Acceptable 0,00

No pictures to display

Alloy rim R L polished, Scratch(es), Acceptable 0,00

No pictures to display

Roof pillar L, Dent(s), Acceptable 0,00

No pictures to display

Roof, Dent(s), LI - Repair and paint (complete) 481,50



Outer door handle R L, Scratch(es), E - Replace 0,00

